

# GENERAL PROCESS AND OPERATION SPECIFICATION

## Nordson March CS-1701 RIE

### I. SCOPE

1. The purpose of this document is to describe the requirements and basic operating instructions for the March RIE. The March is a reactive ion etching (RIE) system excellent for silicide etching and anisotropic etching of nitrides, oxides, and polyimides.

### II. SAFETY

1. You must be trained and signed off to use this equipment.
2. Keep all doors and protective shields in place before operating this equipment.
3. Use care when operating around high voltage, RF energy, or high temperatures.
4. High-pressure gas cylinders for this tool are stored in the service corridor. Ask a staff member for assistance in changing out gases.
5. When the chamber is open, do not touch the inside of the chamber or the gas showerhead.
6. Beware of residual process gasses when opening the chamber. Do not skip the purge step. The tool will not automatically purge the chamber like other tools do.
7. If you are unsure about any procedure or indication while operating this equipment, contact a staff member or trainer for assistance.

### III. APPLICABLE DOCUMENTS, MATERIALS AND REQUIREMENTS

1. For more information on the tool and its processes, AggieFab staff can provide an equipment manual upon request.
2. This tool is configured to run with Ar, O<sub>2</sub>, and CF<sub>4</sub>. Nitrogen is only used to vent the chamber.
3. Gases are stored in the service corridor but are available via manual controls by the tool.

## IV. OPERATION

1. Load sample:
  - A. The tool should be at atmosphere with nothing else running or on.
  - B. Open the chamber and place sample centered inside.
    - i. Samples can be no larger than 6" in diameter. Pieces are acceptable
    - ii. No kapton tape or sharpie is allowed in the chamber. If you need to mark your samples, do it with a diamond scribe.
2. Pump down the process chamber:
  - A. To close the chamber, you must lift the lid vertically while closing it.
  - B. Make sure the lid is centered and settled down.
  - C. Press red "POWER" button on the March. (Note: March unit only functions as RF tuner, everything else is manually controlled)
  - D. Ensure the black AUTO/MAN switch is set to "Auto!" (up)
  - E. Turn on the pump and the roughing valve.
    - i. The pump is below the table. To turn it on, flip the black switch near the top
    - ii. The roughing valve is on the left side of the tool. To turn it on, align the handle with the pipe.
  - F. Wait for the too to reach base pressure which is about  $8.00E-2$  torr (~ 80 millitorr)
3. Process Setup:
  - A. Flow process Gasses:
    - i. Open any needed gas main valves to allow gas flow.
    - ii. Adjust the needle valves to achieve desired flow rate.
  - B. Set up RF power supply:
    - i. Flip the ON switch on the back of the RF power source.
    - ii. Set the power using the up and down buttons.
      - a. Do not go above 400W!
4. Double check everything is ready to go:
  - A. Ensure each part of the process is ready. (It may help to start at the vacuum pump and move clockwise checking every piece as you go)
    - i. The pump is on.
    - ii. The tool is on (The red "POWER" button is lit).
    - iii. Roughing valve is open.
    - iv. Vent valve is closed.
    - v. Chamber is closed properly.
    - vi. Pressure is acceptable.
      - a. The pressure doesn't have to be below base pressure since the process gasses are already flowing.
    - vii. Gasses flowing and adjusted correctly
    - viii. RF power set correctly.
5. Run process:
  - A. Set a timer
  - B. On the RF power source, press the "ON/OFF" button and start the timer at the same time.
    - i. Make sure the plasma is lit before continuing.

- C. Wait for timer to expire.
  - D. Press the “ON/OFF” button.
  - E. Flip the switch to “OFF” on the back of the RF power supply.
  - F. Close all gas line main valves.
  - G. Let the system pump down to base pressure.
6. Purge the chamber: (**This step is very important!** Gas byproducts may be dangerous)
- A. Wait for the chamber to pump to the original base pressure
  - B. Purge Chamber:
    - i. Open argon.
    - ii. Let the chamber reach a constant pressure.
    - iii. Wait a minute
    - iv. Close Argon.
    - v. Wait for the pressure to slow down.
    - vi. Repeat.
7. Remove sample and turn off tool:
- A. Close roughing valve.
  - B. Press the red “POWER” button on the March.
  - C. Turn off pump.
  - D. Open vent valve
  - E. Wait for the chamber to reach atmosphere. (It’ll happen very quickly)
  - F. Close vent valve and remove sample.
  - G. Close the chamber and leave it at atmosphere.
  - H. Double check everything is closed/turned off.

V. SIGNATURES AND REVISION HISTORY

1. Author of this document: Elijah Colter
2. Author Title or Role: Student Technician
3. Date: 9/17/2021
4. Revision: N/A
5. Revision notes: N/A

Approvals:

Technical Manager Signature: \_\_\_\_\_Sandra G. Malhotra\_\_\_\_\_

Date: \_9/20/2021\_\_\_\_\_

Revision History:

<b>Revision</b>	<b>Author</b>	<b>Date</b>
Original Issue	Elijah Colter	9/17/2021
Rev A		
Rev B		
Rev C		